

ASBESTOS MANAGEMENT SURVEY

Location:
Example

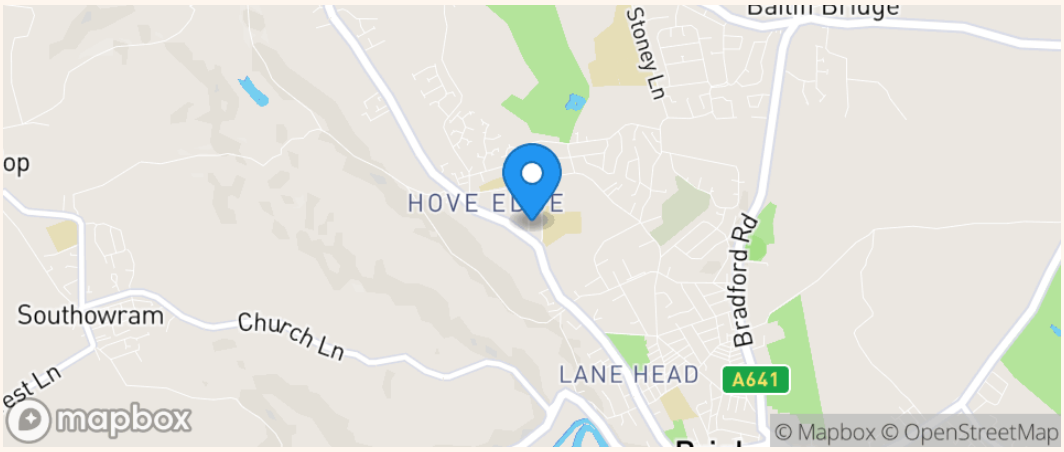
Surveyed On:
16 Aug 2026

Our Ref:
Management Survey

CONNOR CONSULTING
ASBESTOS SURVEYING

Connor Consulting Ltd
07984697626
luke.connorconsulting@hotmail.com

Report Details

Report By	Connor Consulting Ltd
Client	Example
Project	Management Survey
Site Address	Example
Site Coordinates	53.7132547, -1.7967777
Site Location	
Surveyors	Luke Connor
Survey Dates	16 Aug 2026
QC Date	21 Aug 2026

Totals

An overview of the data collected on site, during the survey

Very Low	Low	Medium	High
3	1	0	0

Table of Contents

Sign Off 4

Introduction 4

Executive Summary 4

- Variations to Scope 4
- Summary of Asbestos-Containing Materials 4
- Summary of Non-Asbestos-Containing Materials 5
- Summary of Locations or Items of Limited Access 6

Register 7

Inspected Locations and Items 8

Inspection Photographs 10

Appendices 32

- Floorplans 32
- Bulk Sample Test Certificates 34
- Types of Asbestos Survey 36
- Material Assessment Scores 37
- Asbestos Materials 38

Sign Off

Quality Control
Luke Connor
21st Aug 2026



Introduction

This survey was conducted in accordance with **HSG 264 (Asbestos: The Survey Guide)**. Connor Consulting Ltd cannot accept any liability for loss, injury, damage or penalty issues that arise for reasons of survey scope limitations. Connor Consulting Ltd cannot be held responsible for asbestos potentially present in areas of the building not explicitly specified within the client instruction, not indicated on provided site plans or not physically possible to access. Connor Consulting Ltd cannot be held responsible for any damage caused as part of this survey carried out on your behalf. Due to the nature and necessity of sampling for asbestos some damage is unavoidable and will be limited to that necessary for taking of the samples.

Executive Summary

Variations to Scope

All areas within scope were accessed during the survey

Summary of Asbestos-Containing Materials

These suspected materials were assessed as **asbestos-containing**.

Building / Level / Location	Item	Material	Material Score	Recommendation	Page
Detached Garage / 99 / 012 - Garage	Roof	Cement	4 Very Low	Manage	11
Main Building / 0 / 005 - Room	Coating to ceiling	Textured Coating	3 Very Low	Manage	20
Main Building / 1 / 010 - Bedroom cupboard	Coating to walls	Textured Coating	3 Very Low	Manage	29
Main Building / 1 / 010 - Bedroom cupboard	Panel to rear of door	Insulating Board	6 Low	Manage	30

Summary of Non-Asbestos-Containing Materials

These suspected materials were assessed as **non-asbestos-containing**.

Building / Level / Location	Item	Material	Page
Detached Garage / 99 / 012 - Garage	Windows	Mastic	12
External / 99 / External	Coating to soffits	Textured Coating	13
Main Building / 0 / 001 - Front porch	Coating to ceiling	Textured Coating	14
Main Building / 0 / 001 - Front porch	Floor tiles and bitumen	Composite	15
Main Building / 0 / 003 - Hall	Coating to ceiling	Textured Coating	17
Main Building / 0 / 004 - Living Room	Coating to ceiling	Textured Coating	18
Main Building / 0 / 005 - Room	Coating to ceiling	Textured Coating	19
Main Building / 0 / 005 - Room	Coating to wall	Textured Coating	21
Main Building / 0 / 006 - Bathroom	Coating to ceiling and walls	Textured Coating	22
Main Building / 0 / 007 - Bottom of stairs	Coating to ceiling	Textured Coating	23
Main Building / 0 / 007 - Bottom of stairs	Coating to wall	Textured Coating	24
Main Building / 0 / 008 - Understairs	Coating to ceiling	Textured Coating	25
Main Building / 0 / 008 - Understairs	Coating to wall	Textured Coating	26
Main Building / 1 / 009 - Bedroom	Coating to ceiling	Textured Coating	27
Main Building / 1 / 009 - Bedroom	Coating to walls	Textured Coating	28

Summary of Locations or Items of Limited Access

These locations or items could not be fully accessed during survey. Asbestos should be presumed to be present until a further assessment can be undertaken. Note that the survey scope may exclude other areas - see **Report Details (p. 2)** and **Variations to Scope (p. 4)**.

Building / Level / Location	Inspect	Access / Notes	Photo 1	Photo 2	Page
all locations and items were fully accessed					

Register

Building / Level / Location	Item	Material	Strategy / Sample Id	Extent	Fibre Type	Product Type	Extent of Damage	Surface Treatment	Material Score	Recommendation	Page
Detached Garage / 99 / 012 - Garage	Roof	Cement	Sample 009	15 Sq. M	Chrysotile	1	1	1	4 Very Low	Manage	11
Main Building / 0 / 005 - Room	Coating to ceiling	Textured Coating	Sample 004	5 Sq. M	Chrysotile	1	1	0	3 Very Low	Manage	20
Main Building / 1 / 010 - Bedroom cupboard	Coating to walls	Textured Coating	Strongly Presume 004	5 Sq. M	Chrysotile	1	1	0	3 Very Low	Manage	29
Main Building / 1 / 010 - Bedroom cupboard	Panel to rear of door	Insulating Board	Sample 007	1 Sq. M	Amosite and Chrysotile	2	1	1	6 Low	Manage	30

Inspected Locations and Items

A summary of all locations and items inspected during the survey, including ACMs, non-ACMs and items & locations that could not be fully accessed.

Building / Level / Location	Item	Material	Access / Notes	Material Score	Recommendation	Page
Detached Garage / 99 / 012 - Garage	Roof	Cement		4 Very Low	Manage	11
Detached Garage / 99 / 012 - Garage	Windows	Mastic		0 None		12
External / 99 / External	Coating to soffits	Textured Coating		0 None		13
Main Building / 0 / 001 - Front porch	Coating to ceiling	Textured Coating		0 None		14
Main Building / 0 / 001 - Front porch	Floor tiles and bitumen	Composite		0 None		15
Main Building / 0 / 002 - Kitchen	Ceiling - Plasterboard Walls - Plaster, Brick Floor - Modern floor covering over timber Timber panels to walls Ceramic tiles to walls					16
Main Building / 0 / 003 - Hall	Coating to ceiling	Textured Coating		0 None		17
Main Building / 0 / 004 - Living Room	Coating to ceiling	Textured Coating		0 None		18
Main Building / 0 / 005 - Room	Coating to ceiling	Textured Coating		0 None		19
Main Building / 0 / 005 - Room	Coating to ceiling	Textured Coating		3 Very Low	Manage	20
Main Building / 0 / 005 - Room	Coating to wall	Textured Coating		0 None		21
Main Building / 0 / 006 - Bathroom	Coating to ceiling and walls	Textured Coating		0 None		22
Main Building / 0 / 007 - Bottom of stairs	Coating to ceiling	Textured Coating		0 None		23

table continued from previous page...

Building / Level / Location	Item	Material	Access / Notes	Material Score	Recommendation	Page
Main Building / 0 / 007 - Bottom of stairs	Coating to wall	Textured Coating		0 None		24
Main Building / 0 / 008 - Understairs	Coating to ceiling	Textured Coating		0 None		25
Main Building / 0 / 008 - Understairs	Coating to wall	Textured Coating		0 None		26
Main Building / 1 / 009 - Bedroom	Coating to ceiling	Textured Coating		0 None		27
Main Building / 1 / 009 - Bedroom	Coating to walls	Textured Coating		0 None		28
Main Building / 1 / 010 - Bedroom cupboard	Coating to walls	Textured Coating		3 Very Low	Manage	29
Main Building / 1 / 010 - Bedroom cupboard	Panel to rear of door	Insulating Board		6 Low	Manage	30
Main Building / 1 / 011 - Loft space	Roof - Modern roof felt Walls - Brick Floor - MMMF, plasterboard Timber doors Plasterboard to walls					31

Inspection Photographs

See following pages for additional photographs,
notes and scores for inspected locations and items...

Detached Garage > 99 > 012 - Garage > Roof

Building	Detached Garage	**Level**	99
Location	012 - Garage	**Item**	Roof
Material	Cement	**Extent**	15 Sq. M





Strategy / Sample Id	Sample / 009	**Fibre Type**	Chrysotile
Recommendation	Manage		
General Comments	Roof - Cement Walls - Brick Floor - Concrete Timber windows and doors		

Material Assessment

Product Type (or Debris from Product)	1	**Extent of Damage / Deterioration**	1
Surface Type / Treatment	1	**Asbestos Type**	1
Material Score		4 / Very Low	

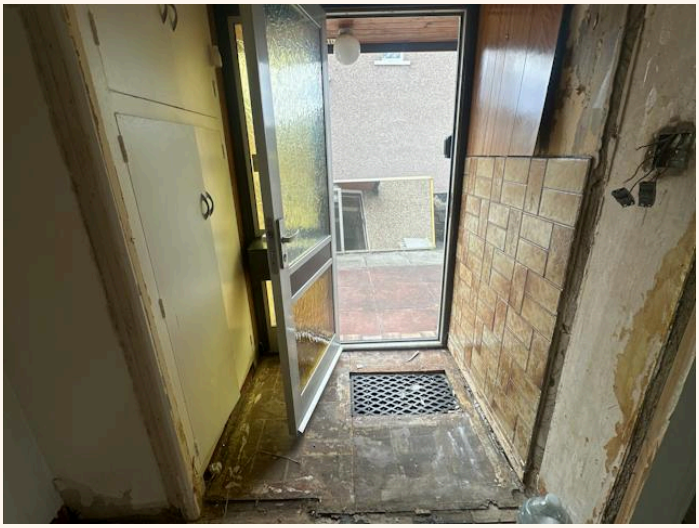
Detached Garage > 99 > 012 - Garage > Windows

Building	Detached Garage	**Level**	99
Location	012 - Garage	**Item**	Windows
Material	Mastic	**Extent**	Small amounts
			
Strategy / Sample Id	Sample / 010	**Fibre Type**	NADIS
General Comments	Roof - Cement Walls - Brick Floor - Concrete Timber windows and doors		

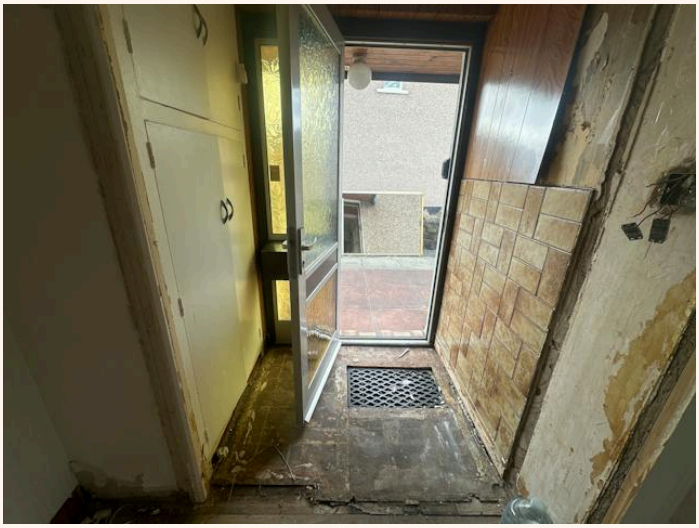
External > 99 > External > Coating to soffits

Building	External	**Level**	99
Location	External	**Item**	Coating to soffits
Material	Textured Coating	**Extent**	20 Sq. M
			
Strategy / Sample Id	Sample / 008	**Fibre Type**	NADIS
General Comments	Roof - Quarry tiles Walls - Brick, pebbledash Floor - Concrete Timber soffits PVC to ceramic undercloaking PVC rainwater goods and downpipes		

Main Building > 0 > 001 - Front porch > Coating to ceiling

Building	Main Building	**Level**	0
Location	001 - Front porch	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	2 Sq. M
			
Strategy / Sample Id	Sample / 001	**Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Timber panels to walls Ceramic wall tiles Timber cupboard with modern electrics to timber panel		

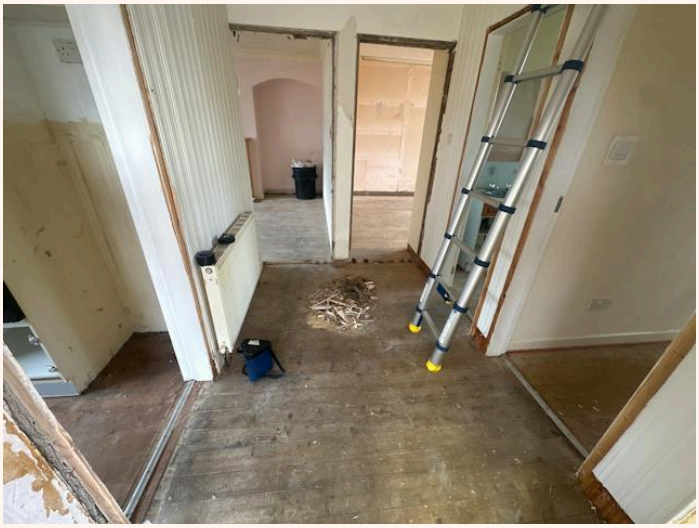
Main Building > 0 > 001 - Front porch > Floor tiles and bitumen

Building	Main Building	**Level**	0
Location	001 - Front porch	**Item**	Floor tiles and bitumen
Material	Composite	**Extent**	2 Sq. M
			
Strategy / Sample Id	Sample / 002	**Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Timber panels to walls Ceramic wall tiles Timber cupboard with modern electrics to timber panel		

Main Building > 0 > 002 - Kitchen > Location Notes

Building	Main Building	**Level**	0
Location	002 - Kitchen	**Item**	
			
Location Notes	Ceiling - Plasterboard Walls - Plaster, Brick Floor - Modern floor covering over timber Timber panels to walls Ceramic tiles to walls		
General Comments	No suspect materials identified		

Main Building > 0 > 003 - Hall > Coating to ceiling

Building	Main Building	**Level**	0
Location	003 - Hall	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	6 Sq. M
			
Strategy / Sample Id	Strongly Presume / 001	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Timber panels to walls Textured wallpaper to walls		

Main Building > 0 > 004 - Living Room > Coating to ceiling

Building	Main Building	**Level**	0
Location	004 - Living Room	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	20 Sq. M
			
Strategy / Sample Id	Strongly Presume / 001	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber PVC window sill Modern fireplace		

Main Building > 0 > 005 - Room > Coating to ceiling

Building	Main Building	**Level**	0
Location	005 - Room	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	10 Sq. M
			
Strategy / Sample Id	Sample / 003	**Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber PVC window sill Timber boxing Textured wallpaper to walls		

Main Building > 0 > 005 - Room > Coating to ceiling

Building	Main Building	**Level**	0
Location	005 - Room	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	5 Sq. M
			
Strategy / Sample Id	Sample / 004	**Fibre Type**	Chrysotile
Recommendation	Manage		
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber PVC window sill Timber boxing Textured wallpaper to walls		

Material Assessment

Product Type (or Debris from Product)	1	**Extent of Damage / Deterioration**	1
Surface Type / Treatment	0	**Asbestos Type**	1
Material Score		3 / Very Low	

Main Building > 0 > 005 - Room > Coating to wall

Building	Main Building	**Level**	0
Location	005 - Room	**Item**	Coating to wall
Material	Textured Coating	**Extent**	8 Sq. M
			
Strategy / Sample Id	Sample / 005	**Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber PVC window sill Timber boxing Textured wallpaper to walls		

Main Building > 0 > 006 - Bathroom > Coating to ceiling and walls

Building	Main Building	**Level**	0
Location	006 - Bathroom	**Item**	Coating to ceiling and walls
Material	Textured Coating	**Extent**	8 Sq. M
			
Strategy / Sample Id	Strongly Presume / 001	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Ceramic wall tiles		

Main Building > 0 > 007 - Bottom of stairs > Coating to ceiling

Building	Main Building	**Level**	0
Location	007 - Bottom of stairs	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	10 Sq. M
			
Strategy / Sample Id	Strongly Presume / 001	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Timber skirting		

Main Building > 0 > 007 - Bottom of stairs > Coating to wall

Building	Main Building	**Level**	0
Location	007 - Bottom of stairs	**Item**	Coating to wall
Material	Textured Coating	**Extent**	10 Sq. M
			
Strategy / Sample Id	Strongly Presume / 005	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Timber skirting		

Main Building > 0 > 008 - Understairs > Coating to ceiling

Building	Main Building	**Level**	0
Location	008 - Understairs	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	2 Sq. M
			
Strategy / Sample Id	Strongly Presume / 001	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Timber skirting Modern boiler		

Main Building > 0 > 008 - Understairs > Coating to wall

Building	Main Building	**Level**	0
Location	008 - Understairs	**Item**	Coating to wall
Material	Textured Coating	**Extent**	4 Sq. M
			
Strategy / Sample Id	Strongly Presume / 005	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Plasterboard Walls - Brick and plaster Floor - Timber Timber skirting		

Main Building > 1 > 009 - Bedroom > Coating to ceiling

Building	Main Building	**Level**	1
Location	009 - Bedroom	**Item**	Coating to ceiling
Material	Textured Coating	**Extent**	25 Sq. M
			
Strategy / Sample Id	Strongly Presume / 003	**Presumed Fibre Type**	NADIS
General Comments	Ceiling - Lathe and plaster Walls - Brick and plaster Floor - Timber PVC window sill Timber skirting		

Main Building > 1 > 009 - Bedroom > Coating to walls

Building	Main Building	**Level**	1
Location	009 - Bedroom	**Item**	Coating to walls
Material	Textured Coating	**Extent**	25 Sq. M
			
Strategy / Sample Id	Sample / 006	**Fibre Type**	NADIS
General Comments	Ceiling - Lathe and plaster Walls - Brick and plaster Floor - Timber PVC window sill Timber skirting		

Main Building > 1 > 010 - Bedroom cupboard > Coating to walls

Building	Main Building	**Level**	1
Location	010 - Bedroom cupboard	**Item**	Coating to walls
Material	Textured Coating	**Extent**	5 Sq. M





Strategy / Sample Id	Strongly Presume / 004	**Presumed Fibre Type**	Chrysotile
Recommendation	Manage		
General Comments	Ceiling - Lathe and plaster Walls - Brick and plaster Floor - Timber PVC window sill Timber skirting		

Material Assessment

Product Type (or Debris from Product)	1	**Extent of Damage / Deterioration**	1
Surface Type / Treatment	0	**Asbestos Type**	1
Material Score		3 / Very Low	

Main Building > 1 > 010 - Bedroom cupboard > Panel to rear of door

Building	Main Building	**Level**	1
Location	010 - Bedroom cupboard	**Item**	Panel to rear of door
Material	Insulating Board	**Extent**	1 Sq. M
			
Strategy / Sample Id	Sample / 007	**Fibre Type**	Amosite and Chrysotile
Recommendation	Manage		
General Comments	Ceiling - Lathe and plaster Walls - Brick and plaster Floor - Timber PVC window sill Timber skirting		

Material Assessment

Product Type (or Debris from Product)	2	**Extent of Damage / Deterioration**	1
Surface Type / Treatment	1	**Asbestos Type**	2
Material Score		6 / Low	

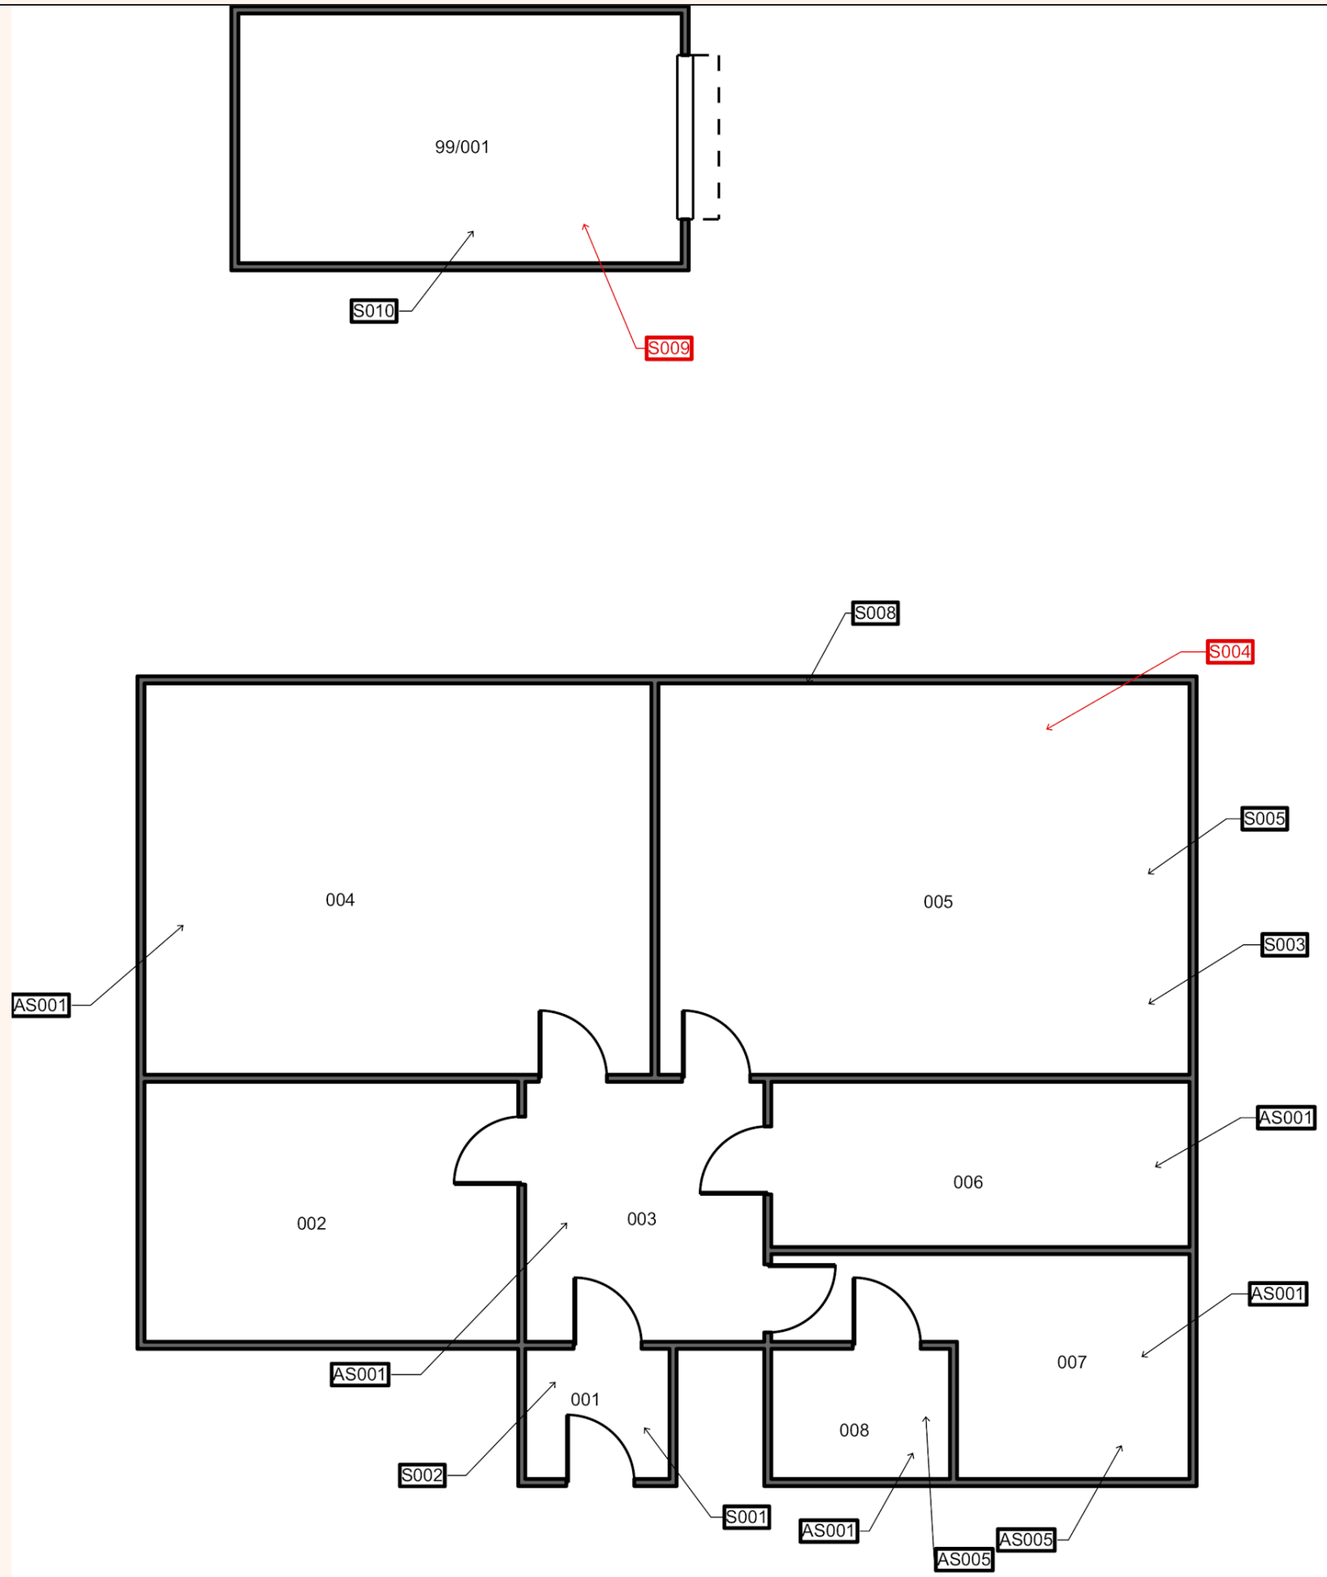
Main Building > 1 > 011 - Loft space > Location Notes

Building	Main Building	**Level**	1
Location	011 - Loft space	**Item**	
			
Location Notes	Roof - Modern roof felt Walls - Brick Floor - MMMF, plasterboard Timber doors Plasterboard to walls		
General Comments	No suspect materials identified		

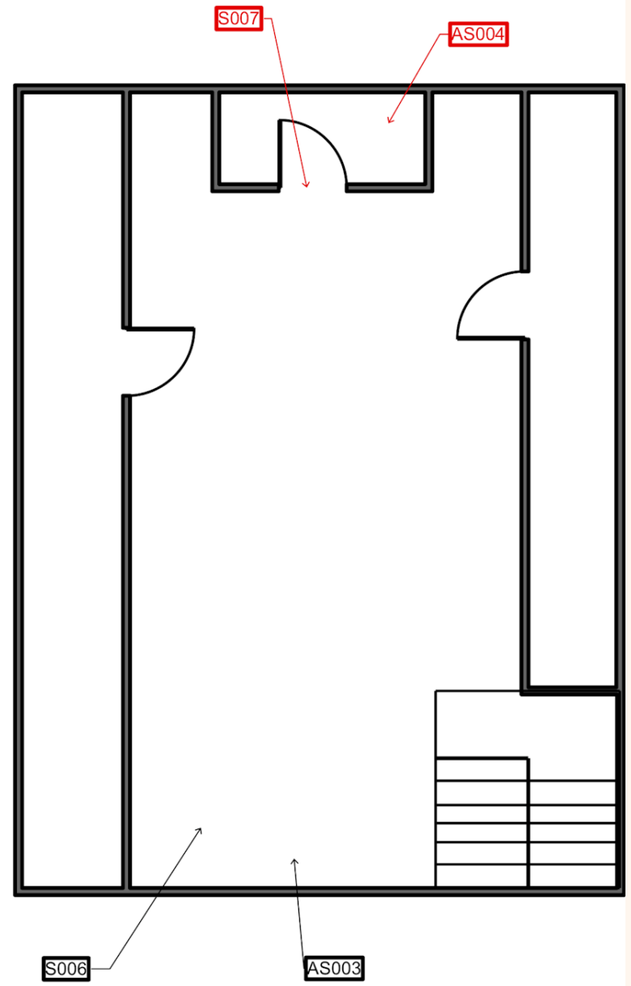
Appendices

Floorplans

See following pages...



Ground



First

Bulk Sample Test Certificates

See following pages...

ENVIRONMENTAL SOLUTIONS LTD

ATHENA ENVIRONMENTAL SOLUTIONS LTD
1 WALLS YARD, RIVERSIDE INDUSTRIAL ESTATE,
SOUTH STREET, ROCHFORD, ESSEX, SS4 1GR
Tel: 01268 761 171
Email: info@athena-env.co.uk
COMPANY REG NUMBER: 07376951
REGISTERED ADDRESS AS ABOVE

UKAS TESTING
4696

CERTIFICATE OF IDENTIFICATION OF ASBESTOS FIBRES

CERTIFICATE NUMBER:	ATH/26/08/0699	**SITE ADDRESS:**	6 MARYVILLE AVENUE
DATE SAMPLED:	13/08/26	**SITE REFERENCE:**	LC 338
NUMBER OF SAMPLES:	10	**CLIENT /SURVEYOR:**	CONNOR CONSULTING LTD
SAMPLES OBTAINED BY:	DELIVERED ON 21/08/26	**CLIENT ADDRESS:**	7 DELF HILL, BRIGHOUSE, CALDERDALE, WEST YORKSHIRE, HD6 3NL
		PHONE NUMBER:	N/A
DATE ANALYSED AND BY:	21/08/26	Tommy Mulligan - Laboratory Analyst	
DATE ISSUED & AUTHORISED BY:	21/08/26	Brett Hopson – Technical Manager	
COMMENTS:			

RESULTS

SAMPLE NUMBER	CLIENT NUMBER	SAMPLE LOCATION	FIBRE TYPE DETECTED	COMMENTS
1.	S001	FRONT PORCH – TEXTURED COATING	NADIS	TEXTURED COATING
2.	S002	FRONT PORCH – FLOOR COVER AND FLOOR TILE	NADIS	VINYL & BITUMEN
3.	S003	ROOM – TEXTURED COATING	NADIS	TEXTURED COATING
4.	S004	ROOM – TEXTURED COATING	CHRYSOTILE	TEXTURED COATING
5.	S005	ROOM – TEXTURED COATING	NADIS	TEXTURED COATING
6.	S006	ROOM – TEXTURED COATING	NADIS	TEXTURED COATING
7.	S007	CUPBOARD – INSULATION BOARD	AMOSITE / CHRYSOTILE	INSULATION BOARD
8.	S008	EXTERNAL – TEXTURED COATING	NADIS	TEXTURED PAINT
9.	S009	EXTERNAL – CEMENT	CHRYSOTILE	CEMENT
10.	S010	EXTERNAL - MASTIC	NADIS	MASTIC

KEY: CHRYSOTILE (WHITE ASBESTOS) - CROCIDOLITE (BLUE ASBESTOS) – AMOSITE (BROWN ASBESTOS)
NADIS (NO ASBESTOS DETECTED IN SAMPLE) - TREMOLITE, ANTHOPHYLLITE & ACTINOLITE (LESS COMMON ASBESTOS FIBRE TYPES)

Note: When a trace of asbestos fibres are reported this represents only one or two fibres identified during PLM analysis.
Note: The material type reported is an opinion of the analyst only and does not form part of the ATHENA UKAS accreditation.
Note: Samples will be kept for a minimum of 6 months and all records and reports pertaining to the analysis archived for a minimum of 5 years.
Note: This Certificate of Identification of Asbestos Fibres can only be reproduced in full unless written approval from Athena has been obtained.
Note: If the sample condition or size is deemed unacceptable or unsatisfactory by the analyst, the client will be contacted.
Note: All samples are analysed at the Athena Laboratory, 1 Walls Yard, Riverside Ind. Est. South Street, Rochford, Essex, SS4 1GR
Note: The results apply to the sample as received & only to the items tested.
Samples have been analysed to determine the presence of asbestos fibres using Athena Environmental Solutions "in house" method of polarised light microscopy and central stop dispersion staining based on HSG 248. The site address and sample locations are given by the client and Athena are not responsible for the accuracy or competence of these details or of the sampling

BULK 001 VERSION 10 – 30/04/2026

PAGE 1 OF 1

Types of Asbestos Survey

HSG 264 (Asbestos: The Survey Guide) describes two types of survey:

Management Surveys

A management survey is the standard survey. Its purpose is to locate, as far as reasonably practicable, the presence and extent of any suspect ACMs in the building which could be damaged or disturbed during normal occupancy, including foreseeable maintenance and installation, and to assess their condition. Management surveys can involve a combination of sampling to confirm asbestos is present or presuming asbestos to be present.

Refurbishment and Demolition Surveys

A refurbishment and demolition survey is needed before any refurbishment or demolition work is carried out. This type of survey is used to locate and describe, as far as reasonably practicable, all ACMs in the area where the refurbishment work will take place or in the whole building if demolition is planned. The survey will be fully intrusive and involve destructive inspection, as necessary, to gain access to all areas, including those that may be difficult to reach. A refurbishment and demolition survey may also be required in other circumstances, eg when more intrusive maintenance and repair work will be carried out or for plant removal or dismantling.

Material Assessment Scores

Where ACMs have been identified or presumed, a material score is calculated in accordance with HSG 264 (Asbestos: The Survey Guide). The value assigned to each of the four sample variables is added together to give a total material score between 2 and 12.

Sample Variable	Score	Examples of Score
Product Type (or Debris from Product)	1	Asbestos reinforced composites (plastics, resins, mastics, roofing felts, vinyl floor tiles, semi-rigid paints or decorative finishes, asbestos cement etc)
	2	Asbestos insulating board, mill boards, other low density insulation boards, asbestos textiles, gaskets, ropes and woven textiles, asbestos paper and felt
	3	Thermal insulation (eg pipe and boiler lagging), sprayed asbestos, loose asbestos, asbestos mattresses and packing
Extent of Damage / Deterioration	0	Good condition: no visible damage
	1	Low damage: a few scratches or surface marks; broken edges on board, tiles etc.
	2	Medium damage: significant breakage of materials or several small areas where material has been damaged revealing loose asbestos fibres
	3	High damage or delamination of materials, sprays and thermal insulation. Visible asbestos debris.
Surface Treatment	0	Composite materials containing asbestos: reinforced plastics, resins, vinyl tiles
	1	Enclosed sprays and lagging, asbestos insulating board (with exposed face painted or encapsulated), asbestos cement sheets etc.
	2	Unsealed asbestos insulating board, or encapsulated lagging and sprays
	3	Unsealed laggings and sprays
Asbestos Type	1	Chrysotile
	2	Amphibole asbestos excluding crocidolite
	3	Crocidolite

The material score determines the potential for a material to release asbestos fibres when disturbed. This score is then categorised to describe the potential:

Material Score	2	3	4	5	6	7	8	9	10	11	12
Category	Very Low			Low		Medium			High		

Asbestos Materials

Asbestos is a naturally occurring mineral composed of soft and flexible fibers that are resistant to heat, electricity and corrosion. These qualities make the mineral useful, but they also make asbestos exposure highly toxic.

Asbestos is a group of six naturally occurring fibrous minerals composed of thin, needle-like fibers. Exposure to asbestos causes several cancers and diseases, including mesothelioma and asbestosis.

Asbestos Morphology

Mineral Group	Fibre Type	Common Name
Serpentine	Chrysotile	White
Amphibole	Amosite	Brown
	Crocidolite	Blue
	Anthophyllite	n/a
	Tremolite	n/a
	Actinolite	n/a

Note: *Anthophyllite was used in limited quantities for insulation products and construction materials. It also occurs as a contaminant in chrysotile asbestos, vermiculite and talc. Tremolite and actinolite are not used commercially, but they can be found as contaminants in chrysotile asbestos, vermiculite and talc.*